




## 2010 43QGP Allegro Bus

12/1/2012



**64 – FYI – REPLACING THE DOMETIC 4310 TOILET FLUSH SWITCH.** This is one of those things that happens when you least like for it to occur. After finishing your business you depress the toilet flush lever and nothing happens, no water and no dump action. After moving the lever between water fill and dump what seems to be a dozen times you finally succeed in getting the toilet to flush, so what do you do now. My best suggestion get the dump switch replaced before sometime in the future you will not get the toilet to dump no matter what you do, so get it repaired before a real crisis occurs.



Our coach is one of the fortunate coach's with a Dometic 4310 gravity toilet which has a removable cover over the water fill/dump switch.

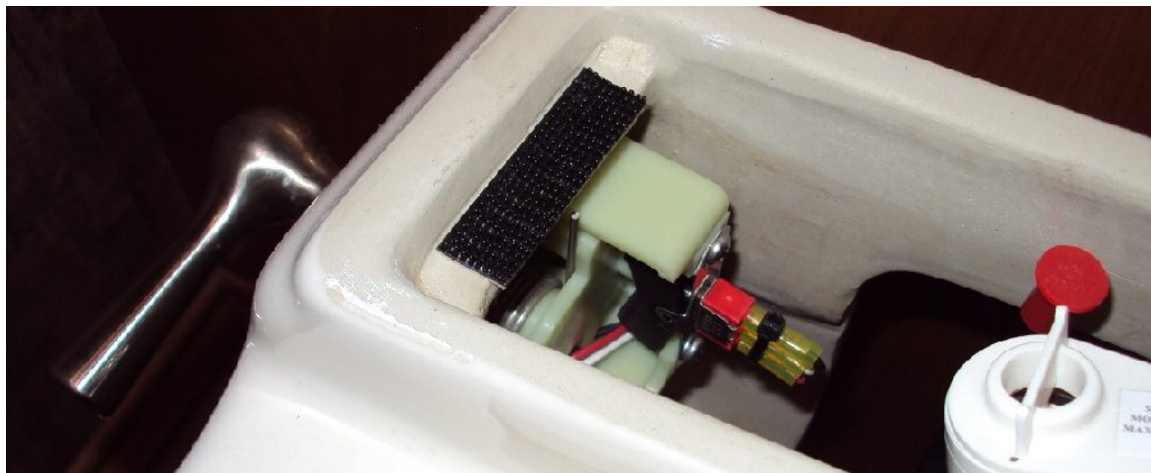

The first item, remove the lever using 1/8" Allen wrench, the screw is located under the lever. Second item, remove the three screws keeping the dump mechanism and switch mounted to the toilet.

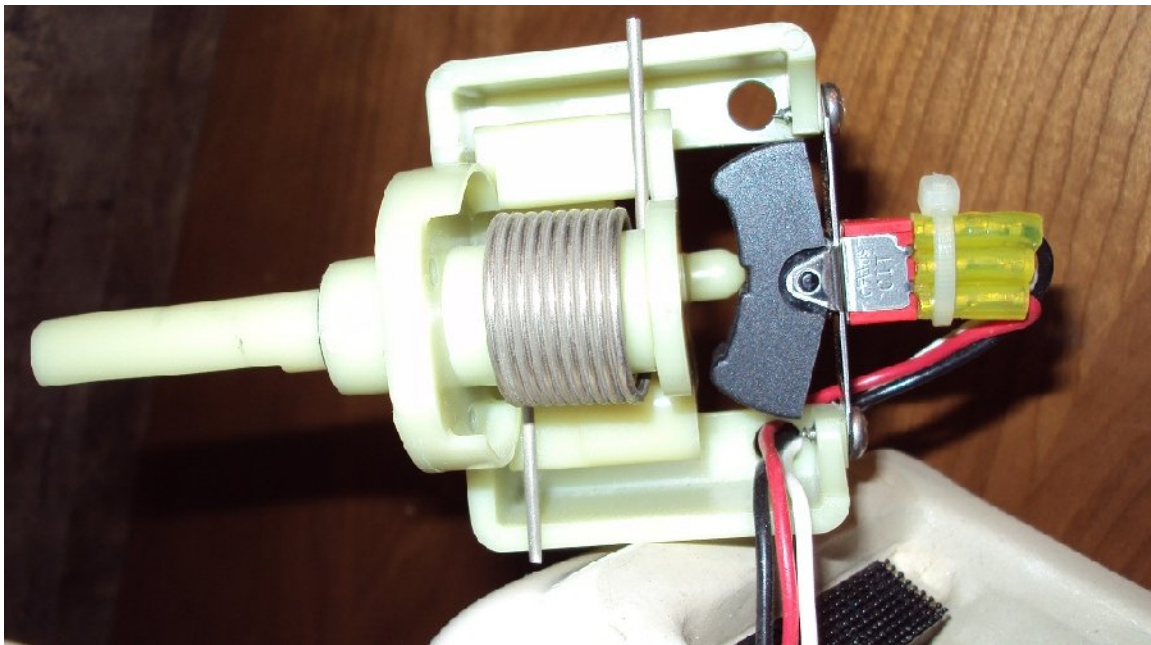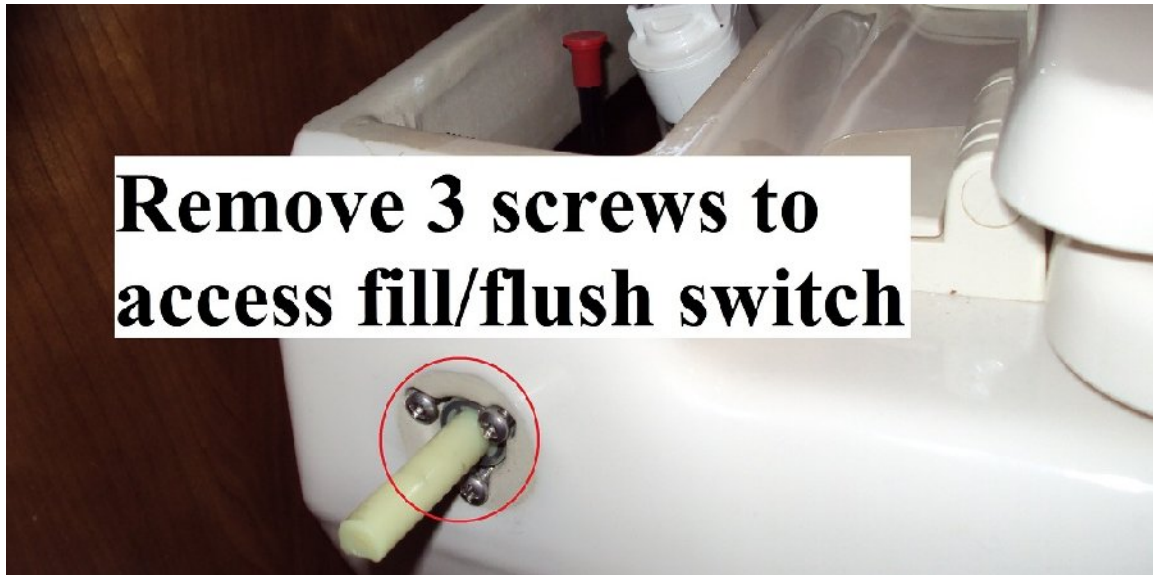

When you get to this point cut the white zip tie, remove the two switch screws remove the three slip on connectors from the three switch terminals. Plug the three slip on connectors on the new switch, reinstall the two switch screws, the three screws which hold the flush/dump mechanism in place and reinstall the lever. Install the cover if you are lucky to have a removable cover such as this one in our coach.